

SKU: GK1016 10x10 Trade Show Booth
V2.0



Scan the QR code
to visit the product page.



10x10 Trade Show Booth with SEG Graphics, Counter, Closet, and Monitor Mount

[Assembly Instructions](#)

General Setup Instructions

- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.


Cleaning & Packing

- For Cleaning Metal, Plex, & Laminate Parts:
Use a MILD NON-ABRASIVE cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure.
Heat and UV exposure will warp and fade components.
- Retain all provided Packing Materials.
All provided packing materials are for ease of repacking & component protection.


Disassembly

- For loss prevention, tighten all set screws and locks during disassembly.

Assembly

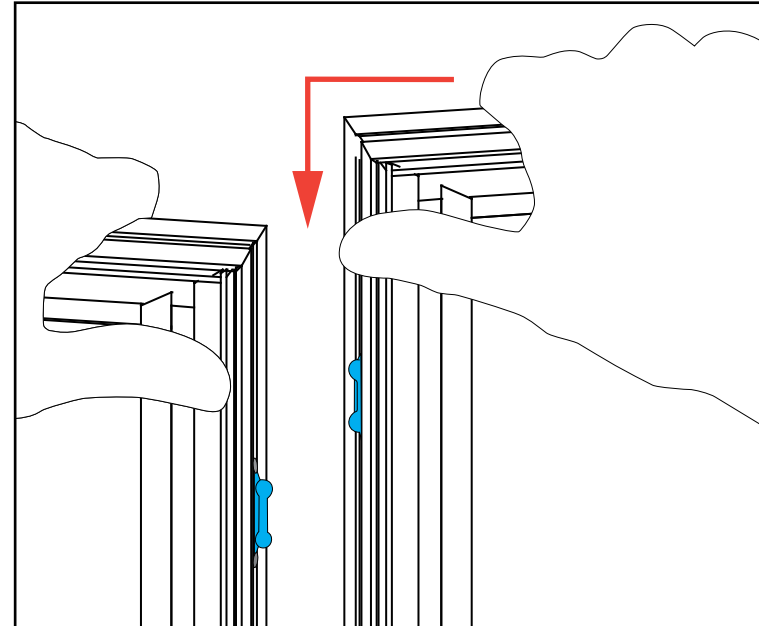

Assembly Cont'd

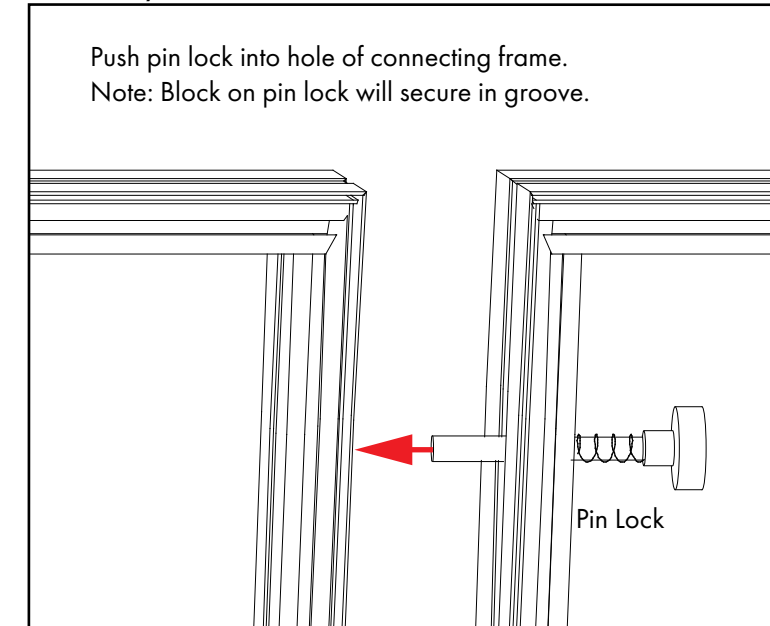


Side-by-Side Assembly

- 1) Frames: Place frames side-by-side with one higher than the other, then slide panel down to lock panels securely together.
- 2) Corner Connectors: Repeat Step 1 for installing corner connectors to frames.

Side-by-Side Disassembly

- 1) Pull pin lock outwards to disengage.
- 2) Pull frames upward and apart at the same time to detach.

SEG Graphic Installation

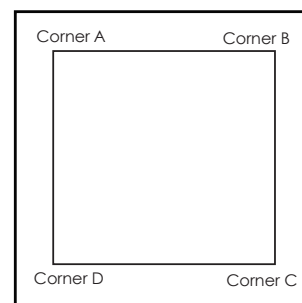


It is important to first insert graphic into each alternate corner, then to the sides of the frame.
If this is not done, graphic will not fit into the frame correctly.



Step 1
Insert corner A.
Turn edge of graphic so silicon welt is perpendicular to face of graphic.
Insert narrow side of welt with fabric to outside into the channel.
Repeat for other side of this corner.



Step 2
Repeat Step 1 for opposite corner C, then insert corner B, followed by corner D, to complete the installation of the corners.

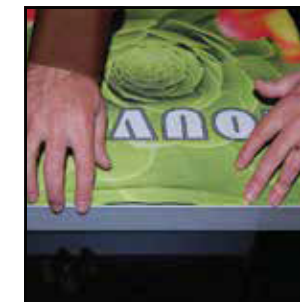

Step 3
Once all corners are inserted, press one silicon edge into channel from corners and work toward the center. Make sure welt is fully inserted into channel. Continue until all sides are done. Smooth out edges of graphic.

Graphic Removal




To remove the graphic from the frame, locate the fabric pull tab.
Gently pull up on the tab to remove the fabric.

Item	Qty.	Description
1	1	Corner Base Plate
2	1	95"h Gravitee Corner Post
3	1	38"w x 95"h Gravitee Panel
4	1	95"h Gravitee Corner Post
5	1	38"w x 95"h Gravitee Panel
6	1	95"h Gravitee Corner Post
7	1	38"w x 95"h Gravitee Panel w/ Door
8	1	95"h Gravitee Corner Post
9	1	38"w x 95"h Gravitee Panel w/ S44
10	1	38"w x 95"h Gravitee Panel w/ S44

Steps:


Refer to the GraviteeAssembly general information page.

- 1) Attach Corner Base Plate [1] to Gravitee panel [10].
See [Base Plate Attachment](#) detail.
- 2) Assemble Gravitee panels & posts [2] through [10] together in numerical order as shown.
- 3) Attach Gravitee light panel to Panel [5] & connect transformers.
See [Light Connection](#) detail.


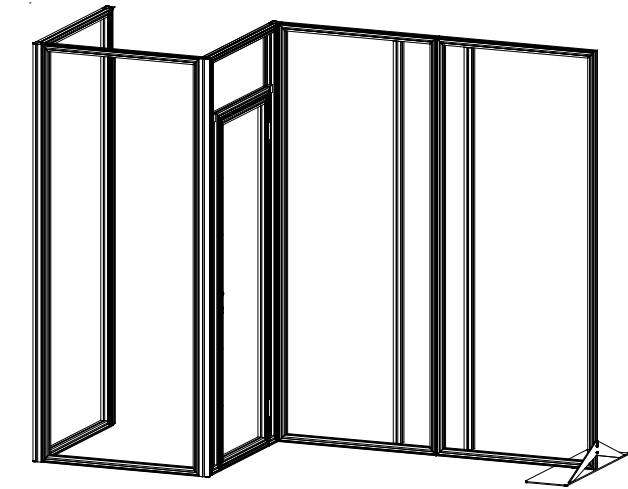


When assembled


* Light Connection

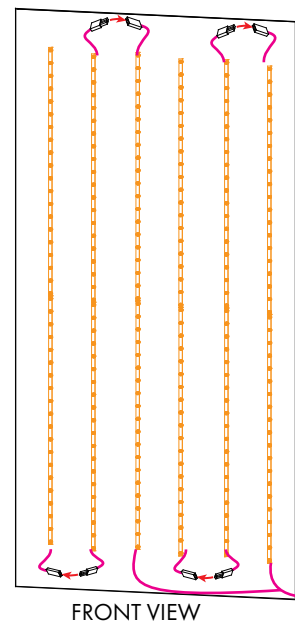



- 1) Connect light strips together & attach transformers.
- 2) Run power cords out hole in back of light panel to power source.
- 3) Affix light panel to back of Gravitee panel using Velcro.

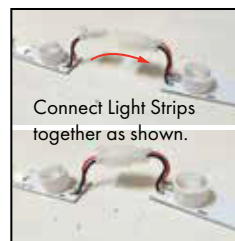


Light to Light Attachment

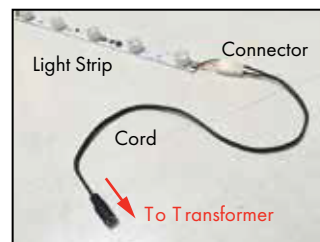

Light to Transformer Attachment

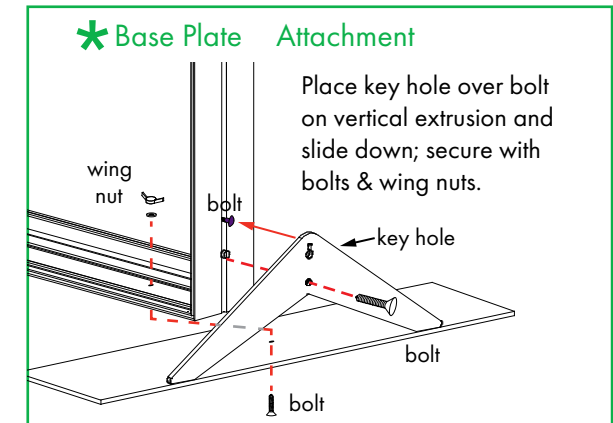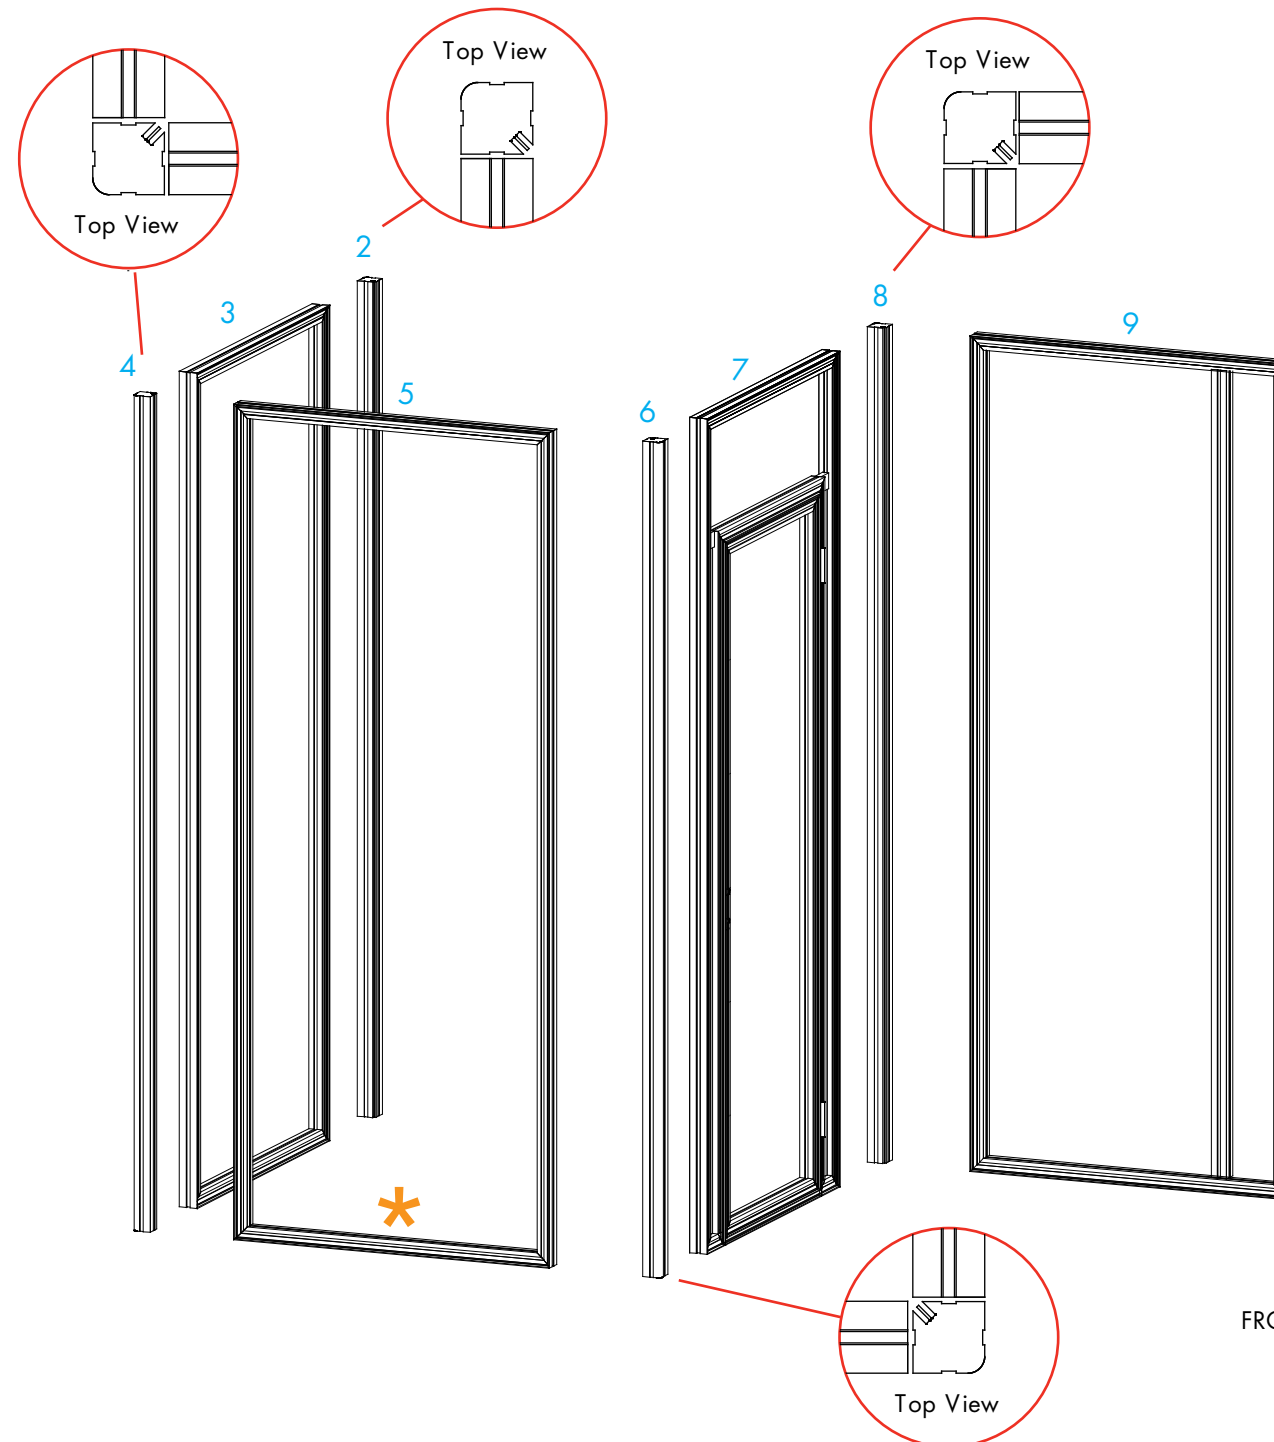

SEG Graphic Installation

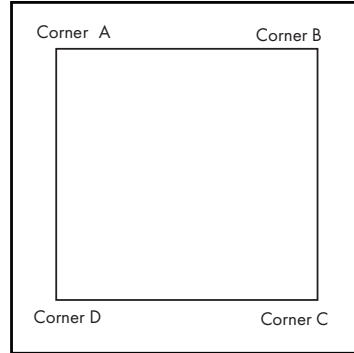


It is important to first insert graphic into each alternate corner, then to the sides of the frame. If this is not done, graphic will not fit into the frame correctly.



Step 1
Insert corner A. Turn edge of graphic so silicon welt is perpendicular to face of graphic. Insert narrow side of welt with fabric to outside into the channel. Repeat for other side of this corner.



Step 2
Repeat Step 1 for opposite corner C, then insert corner B, followed by corner D, to complete the installation of the corners.

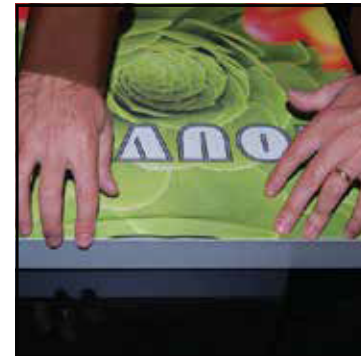

Step 3
Once all corners are inserted, press one silicon edge into channel from corners and work toward the center. Make sure welt is fully inserted into channel. Continue until all sides are done. Smooth out edges of graphic.



Graphic Removal

To remove the graphic from the frame, locate the fabric pull tab. Gently pull up on the tab to remove the fabric.

Steps:

1) Attach SEG Graphics to assembled backwall, as shown.






FRONT VIEW

Steps:

1) Attach monitor mount to vertical extrusions in Panels [9,10].

See [Monitor Mount Attachment](#) detail.

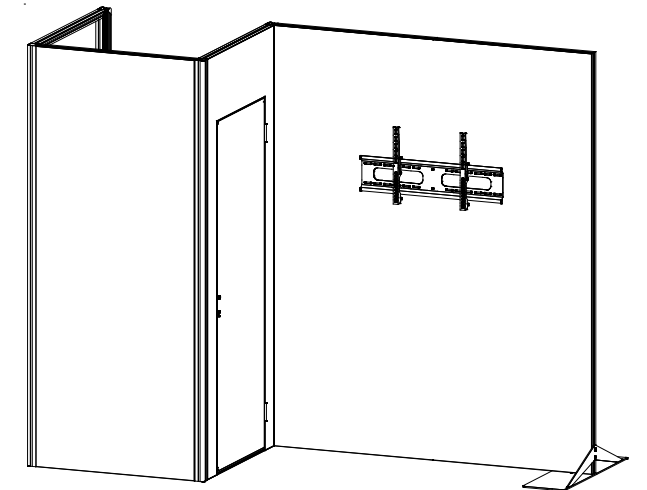
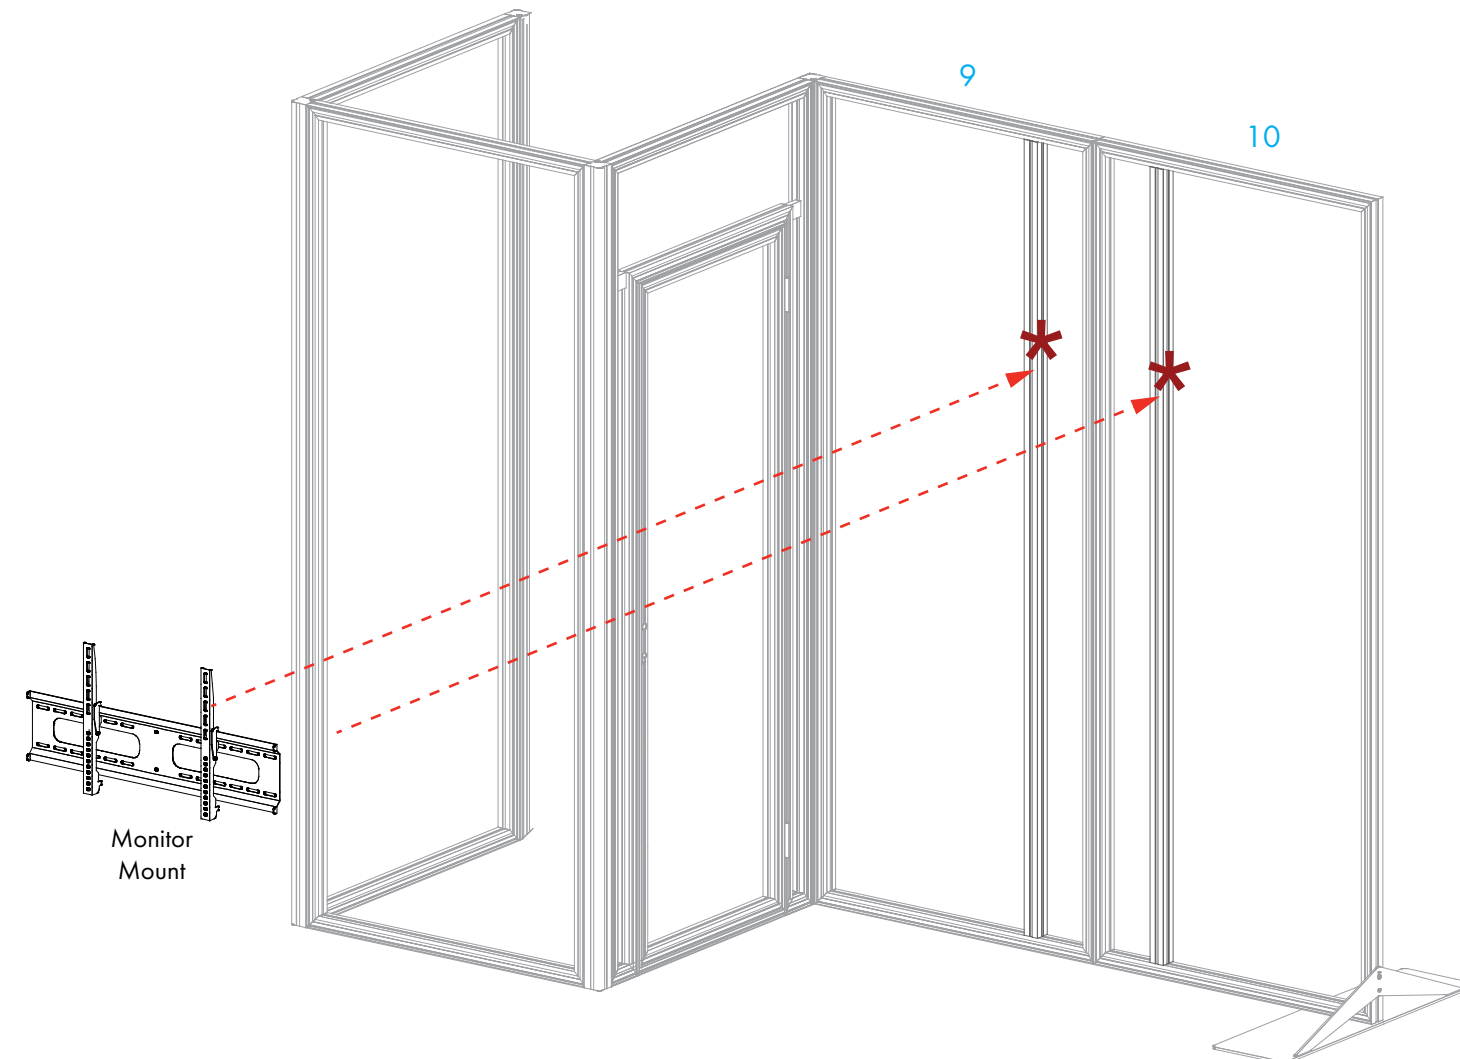
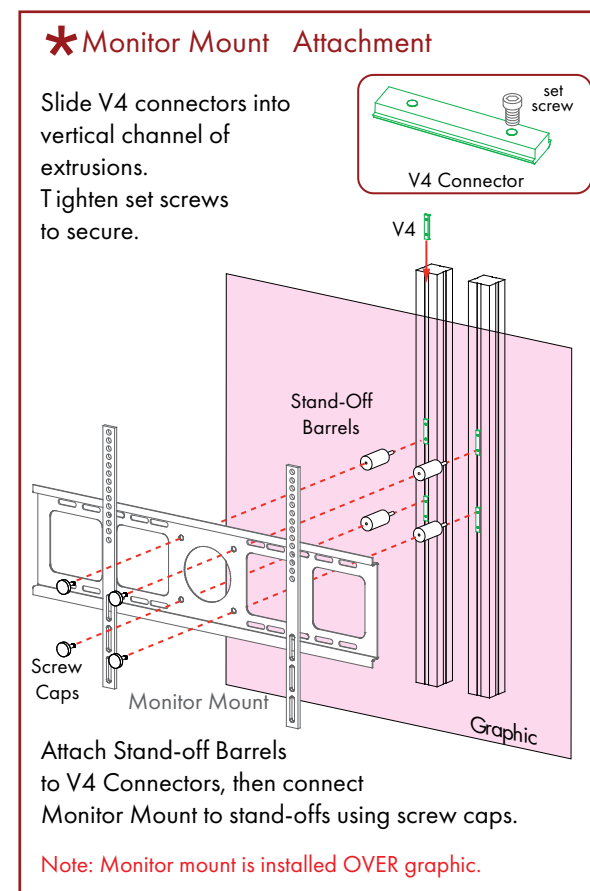


Completed Assembly

Item	Qty.	Description
1	1	37.5"h Gravitee Corner Post w/ S10 & Door Hinges
2	1	14.125"w x 38"h Gravitee panel
3	1	37.5"h Gravitee Corner Post w/ caps
4	1	38"w x 38"h Backlit Gravitee Panel
5	1	37.5"h Gravitee Corner Post w/ caps
6	1	14.125"w x 38"h Gravitee panel
7	1	37.5"h Gravitee Corner Post w/ S10 & Door Hinges
2,2A	1,1	37.094"w Z45 Horizontal Extrusion
3	1	34.417"h Z45 Vertical Extrusion w/ Door Stopper
--	--	Light Panel for Gravitee Panel [4]

Steps:

- 1) Assemble Gravitee panels & posts together, in numerical order as shown, making sure Velcro is facing inward.
- 2) Attach lower horizontal [2] between posts [1] and [7].
- 3) Attach vertical [3] to horizontal [2].
- 4) Attach upper horizontal [2A] between posts [1] and [7], then attach vertical [3] to horizontal [2A].
- 5) Connect doors to posts [1] and [7]. See [Door Connection](#) detail.

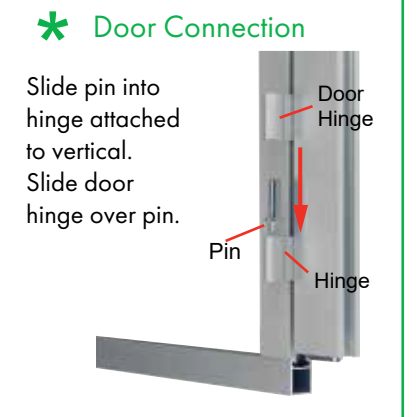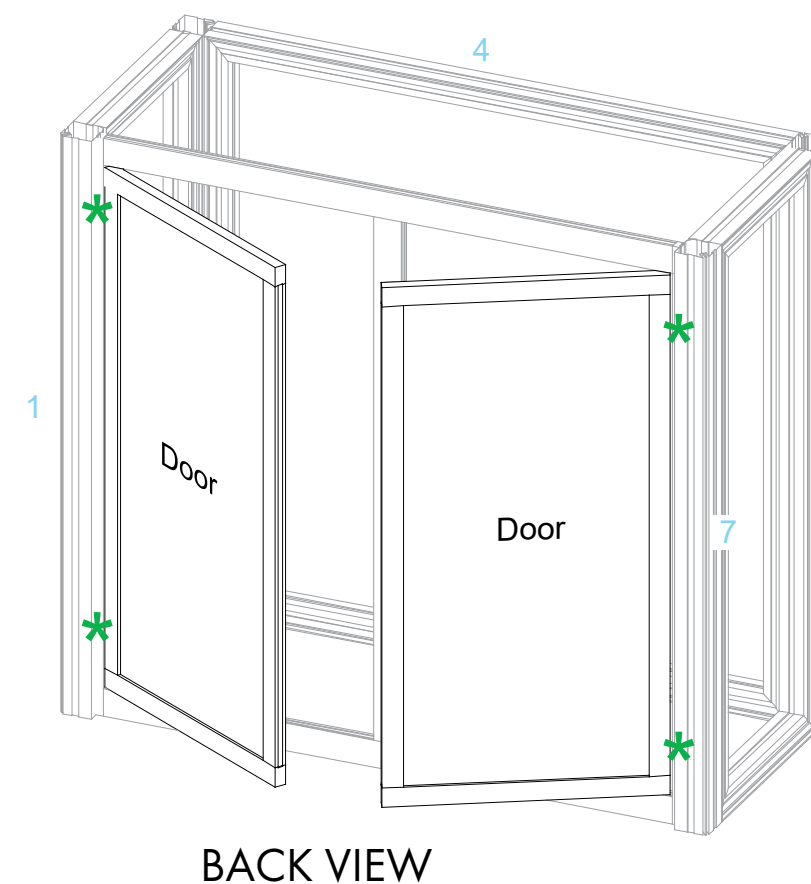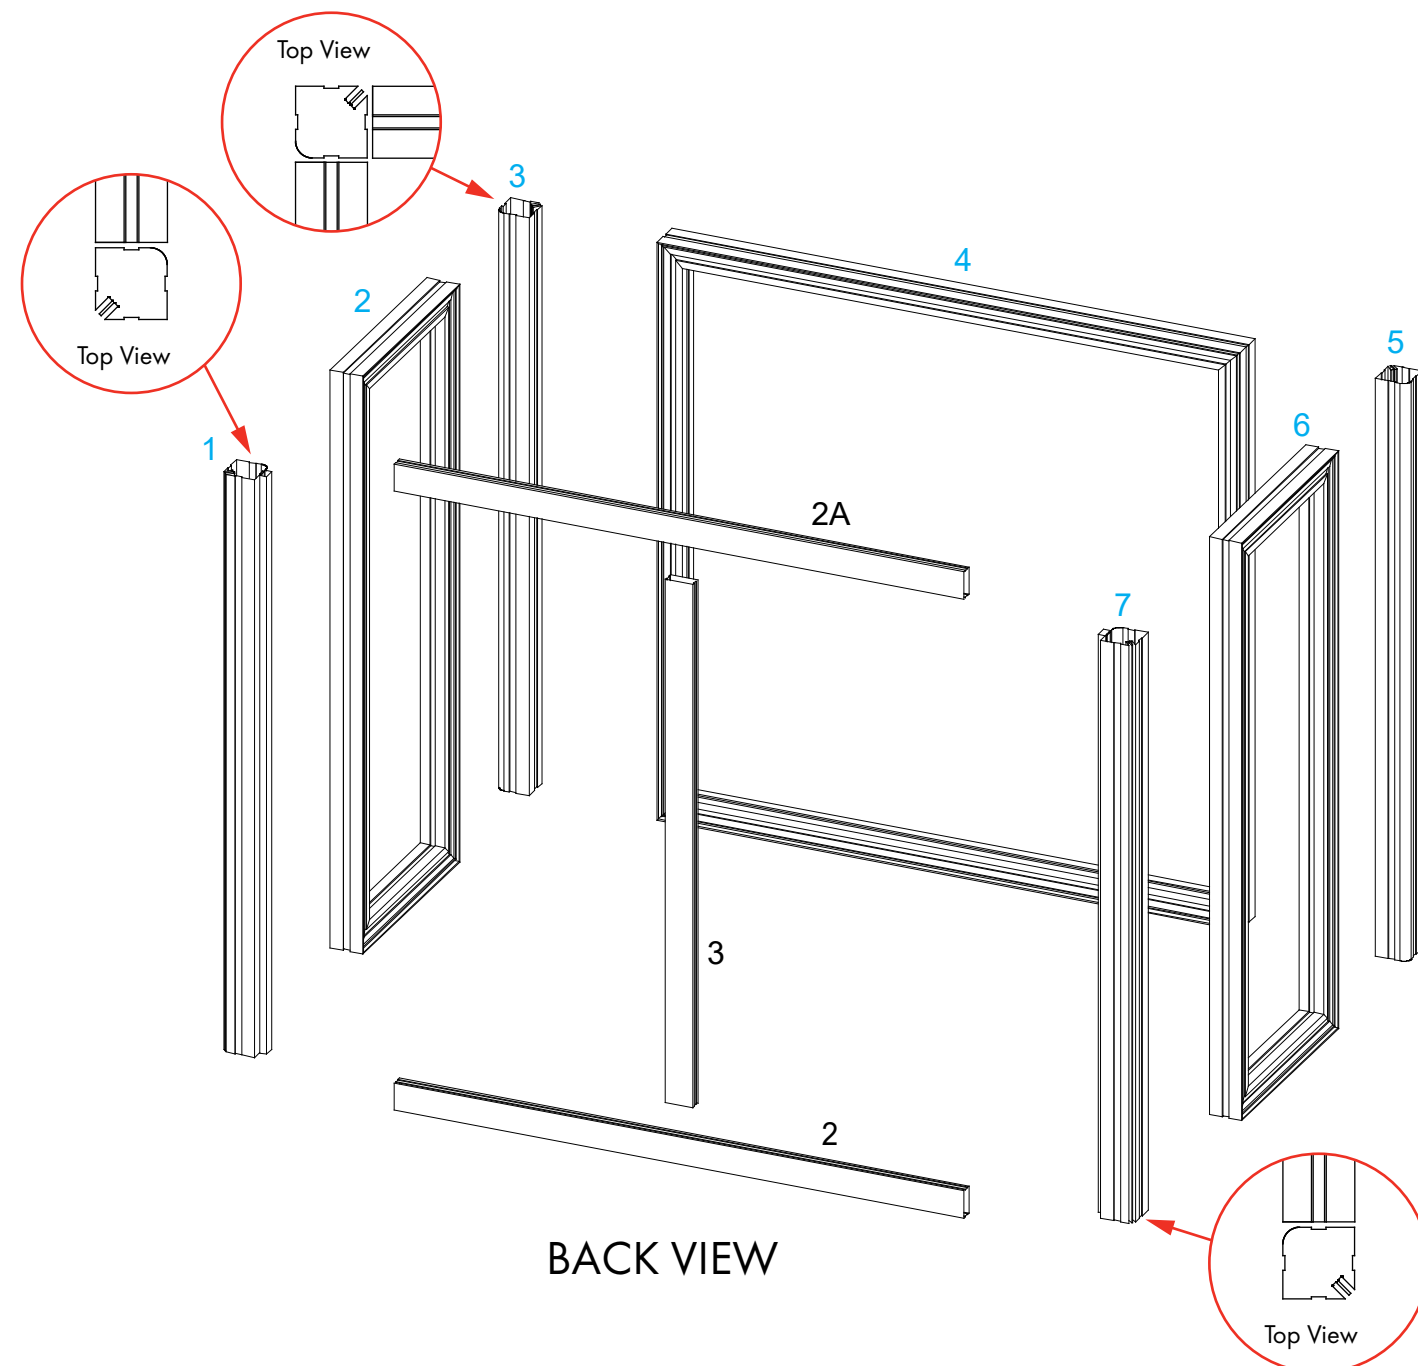

Item	Qty.	Description
--	4	18"h Shelf Supports

- Steps:**
 1) Apply SEG graphics to front and sides of counter assembly.
 See General Information sheet for instruction.
 2) Connect shelf supports to Velcro on inside of [2] and [6],
 then place shelf onto shelf supports.
 3) Lock counter top to horizontals [2] and [6].
 See **Counter Top Lock** detail.

